


This document, together with the concepts and designs presented herein, is intended only for the specific purpose and client for which it was prepared. Please do not prepare reliance on this document without written authorization and approval by Kimley-Horn and Associates, Inc. and its without liability to Kimley-Horn and Associates, Inc.

Section	Sheet No.	Streetname	Beginning	Ending	Approx. Length (ft)	Treatment	Treatment selected	Slurry Seal Area (SF)	Cape Seal Area (SF)	PCC Pavement Replacement Area (SF)	HMA Pavement Area (SF)	Base Repair Area (SF)	HMA Pavement Repair Area (SF)	PCC Repair Area (SF)
1	4	ALEXANDER AVE	SOUTH CITY LIMIT	SOUTH ST	450	24	CRACK SEAL	0	0	0	0	40	0	0
2	4	2ND ST	SOUTH ST	RICHARDSON ST	1,035	25	CRACK SEAL, CAPE SEAL	0	30,040	0	0	940	0	0
3	5	EL PORTAL	BRIDGEWAY	TRACY WY	250	32	CRACK SEAL	0	0	0	0	0	0	0
4	5	SUNSHINE AVE	SAUSALITO BLVD	SAN CARLOS	--	--	PCC FAILURE REPAIR	0	0	0	0	0	0	1,500
5	6	CALEDONIA ST	JOHNSON ST	NAPA ST	1,750	40	CRACK SEAL	0	0	0	0	0	0	0
6	7	SPENCER AVE	SAUSALITO BLVD	PROSPECT AVE	675	25	CRACK SEAL, CAPE SEAL	0	16,920	0	0	0	0	0
7	7	CLOUDVIEW RD	PROSPECT AVE	HWY 101	1,550	25	CRACK SEAL, SLURRY SEAL	38,940	0	0	0	390	580	0
8	8	OLIMA ST	EBBTIDE AVE	COLOMA ST	2,155	30	CRACK SEAL	0	0	0	0	0	0	0
9	9	MILLER AVE	MILLER AVE/SPENCER AVE INTERSECTION	MILLER AVE/SPENCER AVE INTERSECTION	--	--	BASE FAILURE REPAIR	0	0	0	0	2,420	0	0
10	9	ATWOOD AVE	NORTH ST	HARRISON/BULKLEY AVE	950	25	CRACK SEAL, CAPE SEAL	0	21,200	0	0	260	60	0
11	10	WEST ST	VALLEY ST	BRIDGE	245	22	CRACK SEAL, CAPE SEAL	0	5,870	0	0	20	0	0
12	10	FOURTH ST	VALLEY ST	MAIN ST	325	20	CRACK SEAL, CAPE SEAL	0	6,630	0	0	0	20	0
13	11	BEE	BONITA AVE	CALEDONIA	--	--	PCC REPAIR	0	0	0	0	0	0	700
14	11	SAN CARLOS	CALEDONIA AVE	GLEN DR	200	8	HMA SHOULDER PAVE	0	0	0	1,600	0	0	0
15	12	RICHARDSON ST	SECOND ST	WEST ST	735	24	PCC PAVEMENT REPLACEMENT	0	0	26,136	0	0	0	0
16	13	COLOMA AVE	OLIMA AVE	BRIDGEWAY	--	--	HMA SHOULDER PAVE	0	0	0	1,170	0	0	0
17	14	CURREY AVE	CRESCIENTA DR	GLEN DR	1,770	25	CRACK SEAL, CAPE SEAL	0	58,210	0	0	0	120	0
18	15-18	BRIDGEWAY	PRINCESS	N. BRIDGE BLVD	10,500	Varies	CRACK SEAL	0	0	0	0	4,940	760	0
19	19	BONITA ST	BONITA ST/TURNEY ST INTERSECTION	BONITA ST/TURNEY ST INTERSECTION	--	--	PCC PAVEMENT REPLACEMENT	0	0	3,872	0	0	0	0
20	19	EASTERBY	PEARL ST	WOODWARD	--	--	HMA SHOULDER PAVE	0	0	0	0	0	550	0
21	20	RODEO AVE	RODEO AVE	RODEO AVE	--	--	NEW INLET	0	0	0	600	0	0	0
<b>TOTALS</b>								<b>38,940</b>	<b>138,870</b>	<b>30,008</b>	<b>3,370</b>	<b>9,010</b>	<b>2,090</b>	<b>2,200</b>



**Kimley-Horn and Associates, Inc.**  
 © 2013 KIMLEY-HORN AND ASSOCIATES, INC.  
 6130 STONERIDGE MALL RD, STE 370 PLEASANTON, CA 94588  
 PHONE: 925-398-4840 FAX: 925-398-4849  
 WWW.KIMLEY-HORN.COM

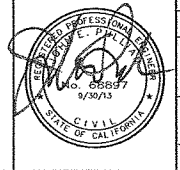

DESIGNED BY TH/JP	DRAWN BY TH/CG	CHECKED BY JP
PLANS PREPARED UNDER SUPERVISION OF: JOHN PULLIAM, P.E. REGISTERED CIVIL ENGINEER		
APRIL 2013 DATE	68897 RCE NO.	



**CONSTRUCTION DETAILS**  
**TREATMENT / REPAIR TABLE**  
 CITY OF SAUSALITO 2013 STREET IMPROVEMENT PROJECT

DRAWING NO CD-01
SHEET 02 of 27
JOB No. 097901001

K:\BA5\_Arby\097901001 - Sausalito Street Repair\Design\CAO\Plan Sheets\02 CD-01 - TREATMENT.dwg, Layout:02 CD-01 - TREATMENT REPAIR TABLE, Apr 19, 2013 - 8:58am Plotted by: donal.carby